

2008 Mercedes-Benz C63

VIN:

Inspection Date: May 02, 2022

Interior	. 2
Exterior	. 8
Tires	13
Underbody	16
Underhood	18
Road Test	23
Additional Notes	24



Inspection Information

Inspection Date: 2022-05-02 Insp Location: Bulleen Client: Cameron

Seller: Daniel Year: 2008 Make: Mercedes-Benz

Model: C63 Km: 140329 VIN

Body Style: SedanTransmission: AutomaticEngine: 8 cylinderDrive Type: RWDInspector: KLAUS STURMPhone: 0421 083 390

Interior Color: Black Exterior Color: Silver Door Count: 4

Interior

G F P	 Fuel Door Release - Not applicable Bonnet Release Trunk Lid Release - Functioning from: remote key / trim switch /luggage lid button
	4. Air Bags - No active recall
	5. Tilt/Telescoping Steering Wheel - Electric steering column functionality
	6. Steering Wheel Controls - Steering wheel leather worn/faded/stained
	7. Horn
	8. Windshield Wiper Operation/Controls
	9. Windshield Washer Operation/Controls
	10. Instrument Panel - Including navigation- destination entry not carried out
	11. Warning Lights
	12. Warning Chimes
	13. Air Conditioning - No smells or odours in system but due to unknown pollen filter replacement status, recommend filter replacement and AC sanitization
	Unsure of pollen filter replacement history
	AC temperature outlet checked = 10C = poor

G = Good - This item is in good condition and/or is performing to standard.

F = Fair - This item is in fair condition and/or is performing adequately.

P = Poor - This item is in poor condition and/or is performing below standard.





	performance is insufficient
14.	Heating System - Air outlet diffuser grille/guide broken x 3
	Defogger/Defroster
16.	Clock
17.	Radio
18.	Audio Player - Not tested
19.	Speakers
20.	Antenna
21.	Lighter/Power Outlet(s)
22.	Interior Courtesy/Map/Dome Light
23.	Glove Box
24.	Glove Box Light
25.	Center Console
26.	Sun Visors
27.	Sun Visors Lights
28.	Vanity Mirrors
29.	Inside Rear View Mirror - Auto dimming functionality unable to reproduce function- recheck under real world light / dark conditions of troubleshoot?
30.	Armrests
31.	Outside Mirror Operation/Controls - And electric folding functionality Rh folding motor/mechanism noisy
32.	Door Locks Manual
33.	Door Locks Automatic - Only 1 key available at test- refer seller if additional key/s available
34.	Child Safety Locks
35.	Window Controls - All tested and functional from all switches, master switch block and remote keys
36.	Door Handles
37.	Heat/Cool Seats - Heated only
38.	Seats - Wear on driver's seat base/backrest bolster and lhf outer






	20	Seat Controls
lacksquare	40.	Headrest
	41.	Seat Belts
	42.	Sunroof/Moonroof - Sliding / tilting functions and inner liner tested ok But
		Operates in jerky manner when closing
		Drains not checked for blockage- recommend cleaning lid seals, channels and drain tubes ASAP and at regular services to prevent blockage and interior leakage and subsequent damage
	43.	Convertible Top - Not applicable
	44.	Headliner
	45.	Carpet
	46.	Floor Mats
	47.	Interior Trim
	48.	Door Panels
	49.	Luggage Compartment
	50.	Luggage Compartment Carpet - Boot floor deformed/damaged
	51.	Luggage Compartment Cargo Net - Not applicable
	52.	Trunk Light
	53.	Jack and Tool Kit





Air Bags

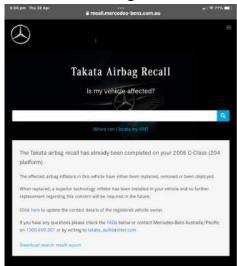

Compulsory Takata Airbag Recall


URGENT SAFETY RECALL - ACT NOW!

Mercedes-Benz Australia/Pacific and Mercedes-Benz Vans Australia Pacific are conducting a compulsary safety recall for certain vehicles equipped with Takata airbags in accordance with the Recall Notice issued by the Assistant Minister to the

Air Conditioning 1



Steering Wheel Controls

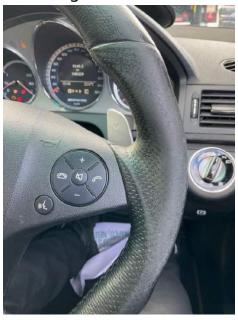

Instrument Panel



Air Conditioning 2



Air Conditioning 3







Heating System 1



Heating System 2



Heating System 3



Radio



Door Locks Automatic




Seats 1







Seats 2

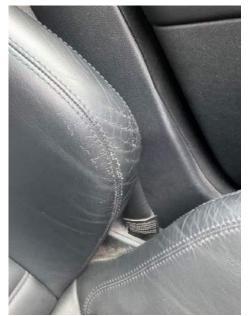

Luggage Compartment



Luggage Compartment Carpet 1



Luggage Compartment Carpet 2



Luggage Compartment Carpet 3



Jack and Tool Kit





Exterior

СЕР	
	54. Windshield - Chipped/cracked/broken
	55. Wiper Blades - Blades streaky and not cleaning well
	56. Windows
	57. Rear Window
	58. Mirrors
	59. Head Lights
	60. High Beams
	61. Parking Lights
	62. Turn Signals
	63. Taillights
	64. Brake Lights
	65. Hazards
	66. License Plate Lights
	67. Reverse Lights
	68. Fog Lights
	69. Running Lights
	70. Side Marker Lights - Not applicable
	71. Body Panels
	72. Front Bumper - Cracks and stone chips
	73. Grille
	74. Hood - chips/scratches
— ——	Gas strut/s dangerously weak- injury risk
	75. Rear Bumper - Minor chips and scratches- commensurate with age/km
	76. Rear Hatch - Not applicable
	77. Trunk
	78. Left Front Fender
	79. Left Front Door - Dents/chips/scratches
	80. Left Rear Fender
$ \overline{A} \square \square $	81. Left Rear Door





🗹 🔲 🔲 82. Right Rear Fender

📝 🔲 🔲 83. Right Rear Door

📝 🔲 🔲 84. Right Front Fender

85. Right Front Door

87. Roof Rack - Not applicable

🔲 🗹 🔲 🛮 88. Trim - Channel strips peeling

▼ □ □ 89. Fuel Door

Windshield 1



Windshield 2



Front Bumper 1








Front Bumper 2

Hood 1

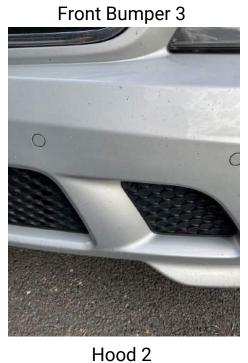













Hood 4 Hood 5 Hood 6







Rear Bumper 1














Left Front Door 2

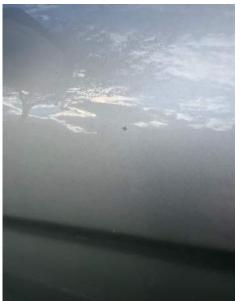

Left Front Door 3



Right Rear Fender



Right Front Door



Roof



Trim 1





Trim 2 Trim 3





Tires

91. Tire Manufacturer/Brand - Not all tyres match Front: goodyear Rear: hankook

- 92. Alignment Tyre wear indicates alignment is recommended
- 93. Left Front Tire
- 94. Left Rear Tire
- 95. Right Rear Tire
- 96. Right Front Tire
- 97. Spare Tire Space saver fitted
- 98. Wheels Wheels scratched/gutter rash x 3
- 99. Wheel Lug Nuts Standard wheel bolts/nuts





Left Front Tire 1



Left Front Tire 2



Left Rear Tire



Right Rear Tire



Right Front Tire



Spare Tire







Wheels 1



Wheels 2



Wheels 3



Wheels 4




Wheel Lug Nuts





Underbody

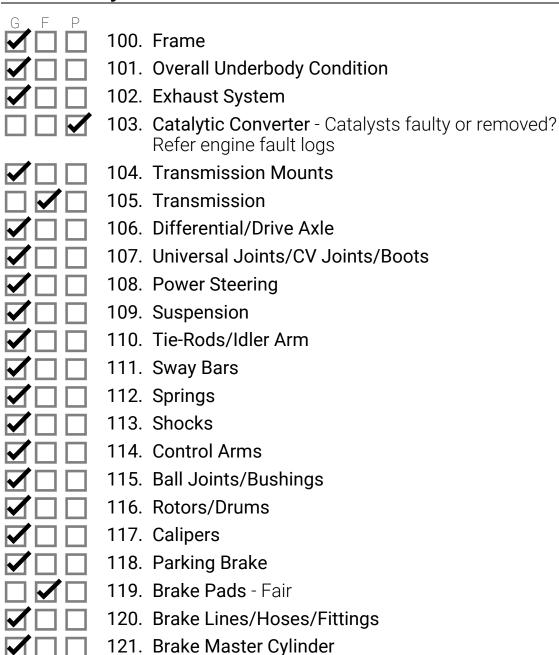

Catalytic Converter 1



Catalytic Converter 2




Catalytic Converter 3








Catalytic Converter 4

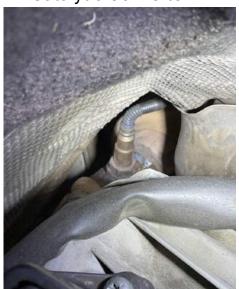

Rotors/Drums 1



Rotors/Drums 2

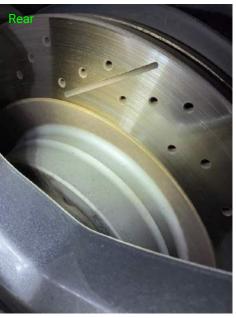

Brake Pads 1



Brake Pads 2





Underhood

G F P		
	122.	Engine Oil - Oil level good and clean Unable to determine oil change history Unsure if correct brand/grade/type has been used for oil changes
	123.	Brake Fluid - Brake fluid moisture content low/good
	124.	Coolant - No oil or sludge evident in coolant Coolant quality tested to - 38C Coolant level low in reservoir
	125.	Power Steering Fluid
	126.	Transmission Fluid - Unable to assess due to transmission type Unable to determine whether scheduled services have been carried out
		Has trans fluid oil in boot
	12/.	Washer Fluid - Washer fluid additive properties weak
	128.	Transfer Case Fluid - Not applicable
	129.	Engine Mounts - New
	130.	Overall Engine Condition - Bad oil leak rhf rocker cover etc No sludge or moisture evident
		Bad oil leak under car- rocker cover or possibly also rear main seal- not possible to determine without extensive covers removal and hoist/clean and recheck
	131.	Engine Belts - Drive belt cracks and wear evident- recomment
	100	replacement
		Engine Hoses/Lines/Fittings
		Radiator - Leaking at top hose neck area- or hose?
	134.	Water Pump - No leaks evident No freeplay
	125	Coolant Recovery Tank
	133.	,
		Coolant Fans/Clutches/Motors
	136.	





139. Starter Operation - Starter motor good- engages well and no noises Starter current low due to weak battery voltage - recheck after recharge
140. Ignition Operation
141. Battery - Note- AGM battery fitted Great condition but recharge recommended
142. Alternator - Charging system tested ok
143. Air Filter - Dirty-needs replacement
144. Fuel Filter - Not checked- refer service history Due to inconsistent/non dealer/non specialist history, unable to determine if carried out- suggest replacement
145. Fuel Pump - No pressure faults logged, Not noisy and no leaks evident
146. Fuel System Operation - No leaks or noises, Ok
147. Underbonnet-general - No signs of tampering with bonnet hinges or guard areas- no previous repairs evident Small cover trim cracked

Engine Oil



Brake Fluid



Coolant 1







Coolant 2



Overall Engine Condition 2



Overall Engine Condition 3





Overall Engine Condition 1



Overall Engine Condition 4








Overall Engine Condition 5



Overall Engine Condition 6



Engine Belts

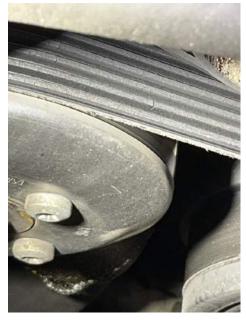

Radiator 1



Radiator 2



Starter Operation





Alternator



Battery 1



Air Filter



Battery 2

Underbonnet-general 1





Underbonnet-general 2










Underbonnet-general 3



Road Test

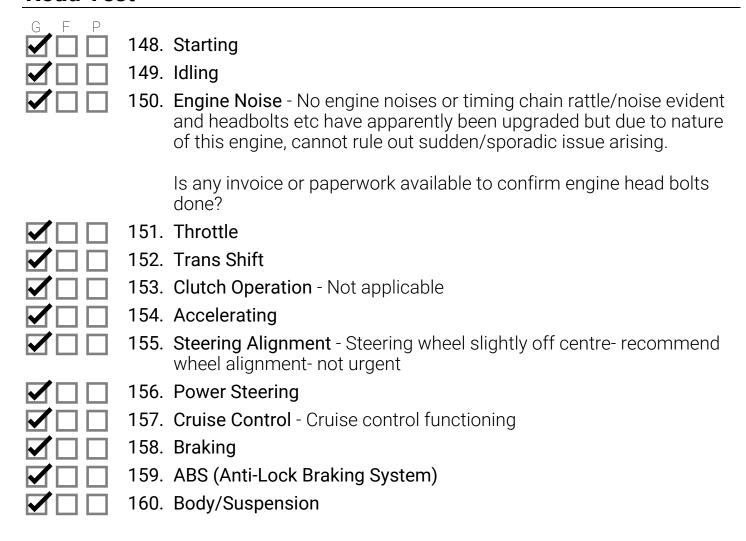



161. Interior Noise Level

Additional Notes

162. Additional Notes: - Car is currently registered

Finance not owing

Manufacturer recall unable to be checked online- refer authorized dealer to clarify

Not recorded as Stolen

Not recorded as written off

Only one key available at time of test-refer seller if any additional key/s are available

G F P

163. Control unit scan - Faults logged-refer scan screens as attached EngineEsp

Оср

Seats

164. Service History - Scattered history/irregular No service stamp since 2020 but filters etc in boot

165. Disclaimer / notes - This inspection is not to be construed as a Roadworthy inspection- nor does it obviate the need for a Roadworthy inspection in the state the vehicle is to be registered in.

Wheels not removed due to able to inspect brakes through wheels without removal.

Compression test not carried out.

Unable to determine if any fluid additives used to cover up pre-existing concerns.

Tested to local conditions and limits.

Completion of roadtest = 140331km

Items marked per colour schedule:

GREEN = GOOD

YELLOW = FAIR


RED = POOR

Note-Report summary only highlights POOR items- this does not mean the car is POOR. Post inspection discussion with inspector is required for explanation and clarification.





Additional Notes: 1

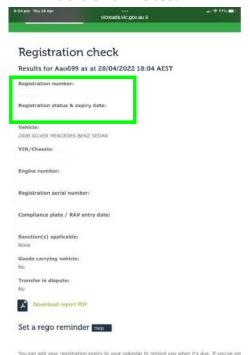

Additional Notes: 2



Additional Notes: 3




Additional Notes: 4



Control unit scan 1



Control unit scan 2

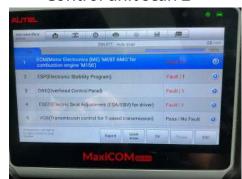





Control unit scan 3



Control unit scan 4




Control unit scan 5



Control unit scan 6



Service History 1

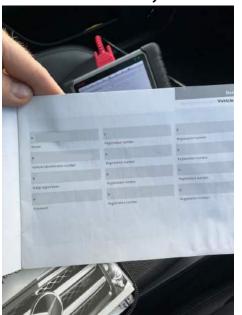

Service History 2







Service History 3



Service History 4




Service History 5




Service History 6



Service History 7

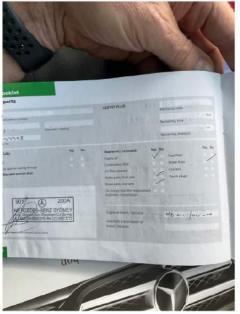


Service History 8

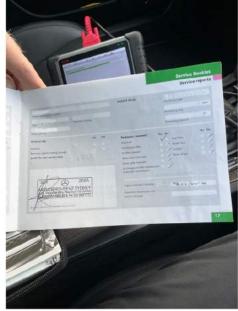






Service History 9

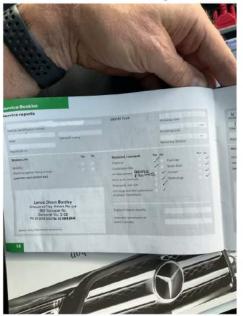

Service History 10



Service History 11

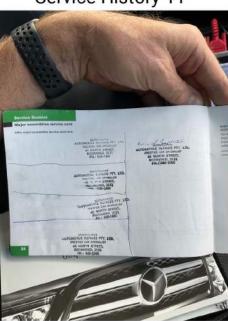

Service History 12






Pictures










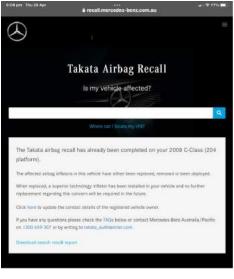

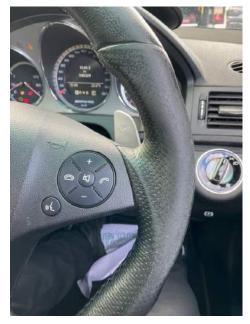

Compulsory Takata Airbag Recall

URGENT SAFETY RECALL - ACT NOW!

Mercedes-Benz Australia/Pacific and Mercedes-Benz Vans Australia Pacific are conducting a compulsary safety recall for certain vehicles equipped with Takata airbans in accordance with the Recall Notice issued by the Assistant Minister to the






















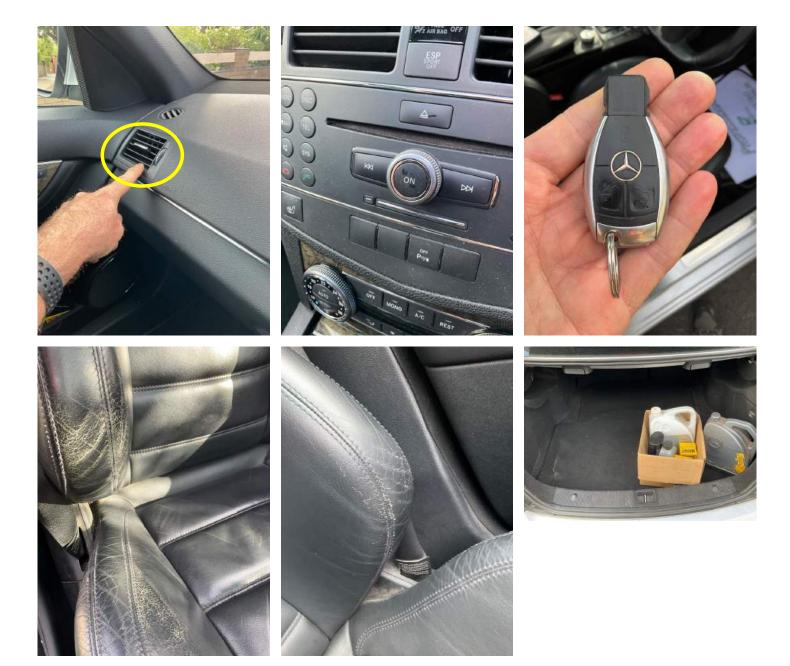






























































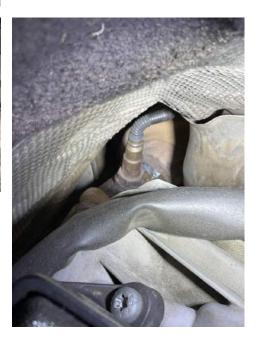















































Summary

Poor

Interior

Air Conditioning - No smells or odours in system but due to unknown pollen filter replacement status, recommend filter replacement and AC sanitization

Unsure of pollen filter replacement history

AC temperature outlet checked = 10C = poor

AC cool but not cold enough- recommend gas pressures check if performance is insufficient

Underbody

Catalytic Converter - Catalysts faulty or removed? Refer engine fault logs

Underhood

Engine Belts - Drive belt cracks and wear evident-recomment replacement

Radiator - Leaking at top hose neck area- or hose?

Air Filter - Dirty-needs replacement